

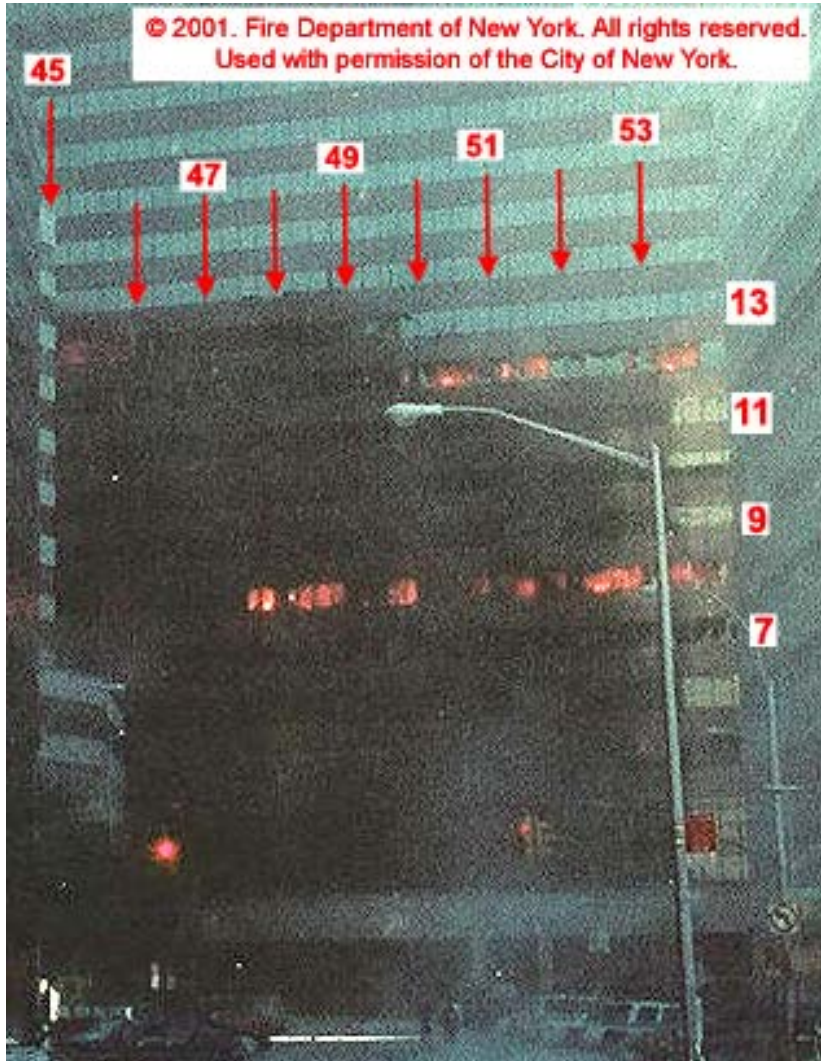


Figure 5-130. View of the north face of WTC 7 taken around 3:41 p.m. $\pm$ 3 min, enlarged from Figure 5-129. The intensities have been adjusted, and column and floor numbers have been added.

While difficult to discern in Figure 5-130, a number of windows are open on the 7th floor. Most, if not all, of the windows between window 7-47A and 7-53D are open. There is no indication of fire on the floor in this photograph. Apparently, fire present in this area around 3:13 p.m. had stopped spreading and had died down by 3:41 p.m.

There are no indications of fires on other floors in this time interval, between 2:57 p.m. and 3:42 p.m. With the exception of Figure 5-123, which indicates that fire was present on the north edge of the east face around 3:10 p.m., there are no images available during this time period that show the fire distributions on the east, west, or south face of WTC 7.

Fires below the 14th Floor, 3:47 p.m. to 4:40 p.m.

Figure 5-131 shows a view of the central region of the north face taken from the video shot from a building to the northwest of the site looking down Greenwich Street at a time estimated as 3:50:13 p.m. with an uncertainty of $\pm$ 3 min. During the approximate 7 min 45 s period between the time when Figure 5-128 and Figure 5-131 were taken, the fire on the 8th floor had spread towards the east and was burning vigorously between Columns 46 and 47 at the later time. Windows on this floor around Column